

Packard **SERVICE TECHNICAL** **Bulletin**

50T-34, Dealer 26
September 13, 1950

To: ZONES AND DEALERS

Subject: REAR QUARTER WATER LEAKS - 24TH SERIES CLUB SEDANS

BODY MODELS 2465-95

Water leaks may be encountered at the rear quarter panels in early 24th Series Club Sedans, body models 2465 and 2495.

When this condition exists, water enters the rear quarter window opening, finds its way between the rear quarter inner panel and the trim panel, and then runs down between these panels to the floor.

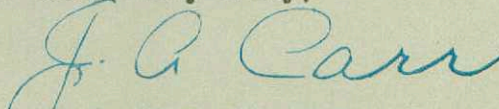
Various revisions at the rear quarters have corrected this condition in bodies now being produced. Correcting these leaks, when they exist in vehicles in service, may be accomplished by installing Rear Quarter Water Shield Kit, part number 436057. Each kit contains two water shields for both rear quarters of one vehicle.

An initial supply of these kits are being shipped to each Zone and additional kits may be ordered if necessary.

Labor for 2 hrs. will be allowed for installing each kit to correct leaks at both rear quarters.

Service Counselor, Vol. 24, No. 8, September, 1950, illustrates and describes the sealing of the quarter panels and the installation of Rear Quarter Water Shield Kit, part number 436057.

Yours very truly,


J. A. Carr, Manager
Parts and Service Department

AED:ljk