



Packard SERVICE TECHNICAL

Bulletin

50T-37, Dealer 29
September 18, 1950

To: ZONES AND DEALERS

Subject: DOOR HANDLE REPLACEMENT - 24TH SERIES

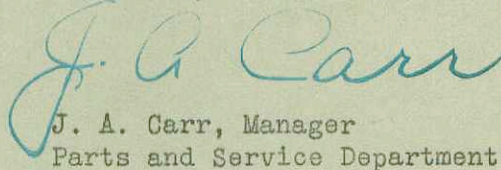
Recent revisions in door outside handles strengthened the handle to prevent breakage at the handle retainer slots.

Strengthening the handle also made it necessary to change the lock cylinder spring and spring retainers in the handle. These new springs and retainers are not interchangeable with the early type.

The Factory Parts Warehouse is shipping only the new heavier handle. When the new handle is used to replace the early type handle, the original lock cylinder may be used; however, the spring and spring retainers must be replaced and the late type should be ordered under the following part numbers:

| | | |
|--------|-------------------------|---------|
| 435214 | Spring | 1 req'd |
| 435212 | Spring Retainer - outer | 1 req'd |
| 435213 | Spring Retainer - inner | 1 req'd |

Yours very truly,


J. A. Carr, Manager
Parts and Service Department

AED:ljk