

Packard **SERVICE TECHNICAL**
Bulletin

50T-44

October 23, 1950

To: ZONES

Subject: HIGH SPEED VIBRATION - MODEL 200

High speed motor vibration may be reported occasionally on the 24th Series 200 model equipped with Ultramatic Drive. The disturbance, when it exists, is particularly noticeable between 80 and 90 miles per hour. In some instances, a disturbance also may be noticeable to a lesser degree at speeds below 80 miles per hour.

A correction has been developed and it will become effective in production as soon as is reasonably possible. Notice of the effective point will be covered in a later bulletin.


A motor cylinder to flywheel housing support kit, part number 436059, is available to correct this disturbance when it is reported on vehicles in service. An initial supply of these kits is being shipped to each Zone. Details of the kit are shown on the reverse side of this bulletin.

Labor for 0.7 hr. will be allowed for installing each kit.

Yours very truly,

J. A. Carr
J. A. Carr, Manager
Parts and Service Department

AED:ljk

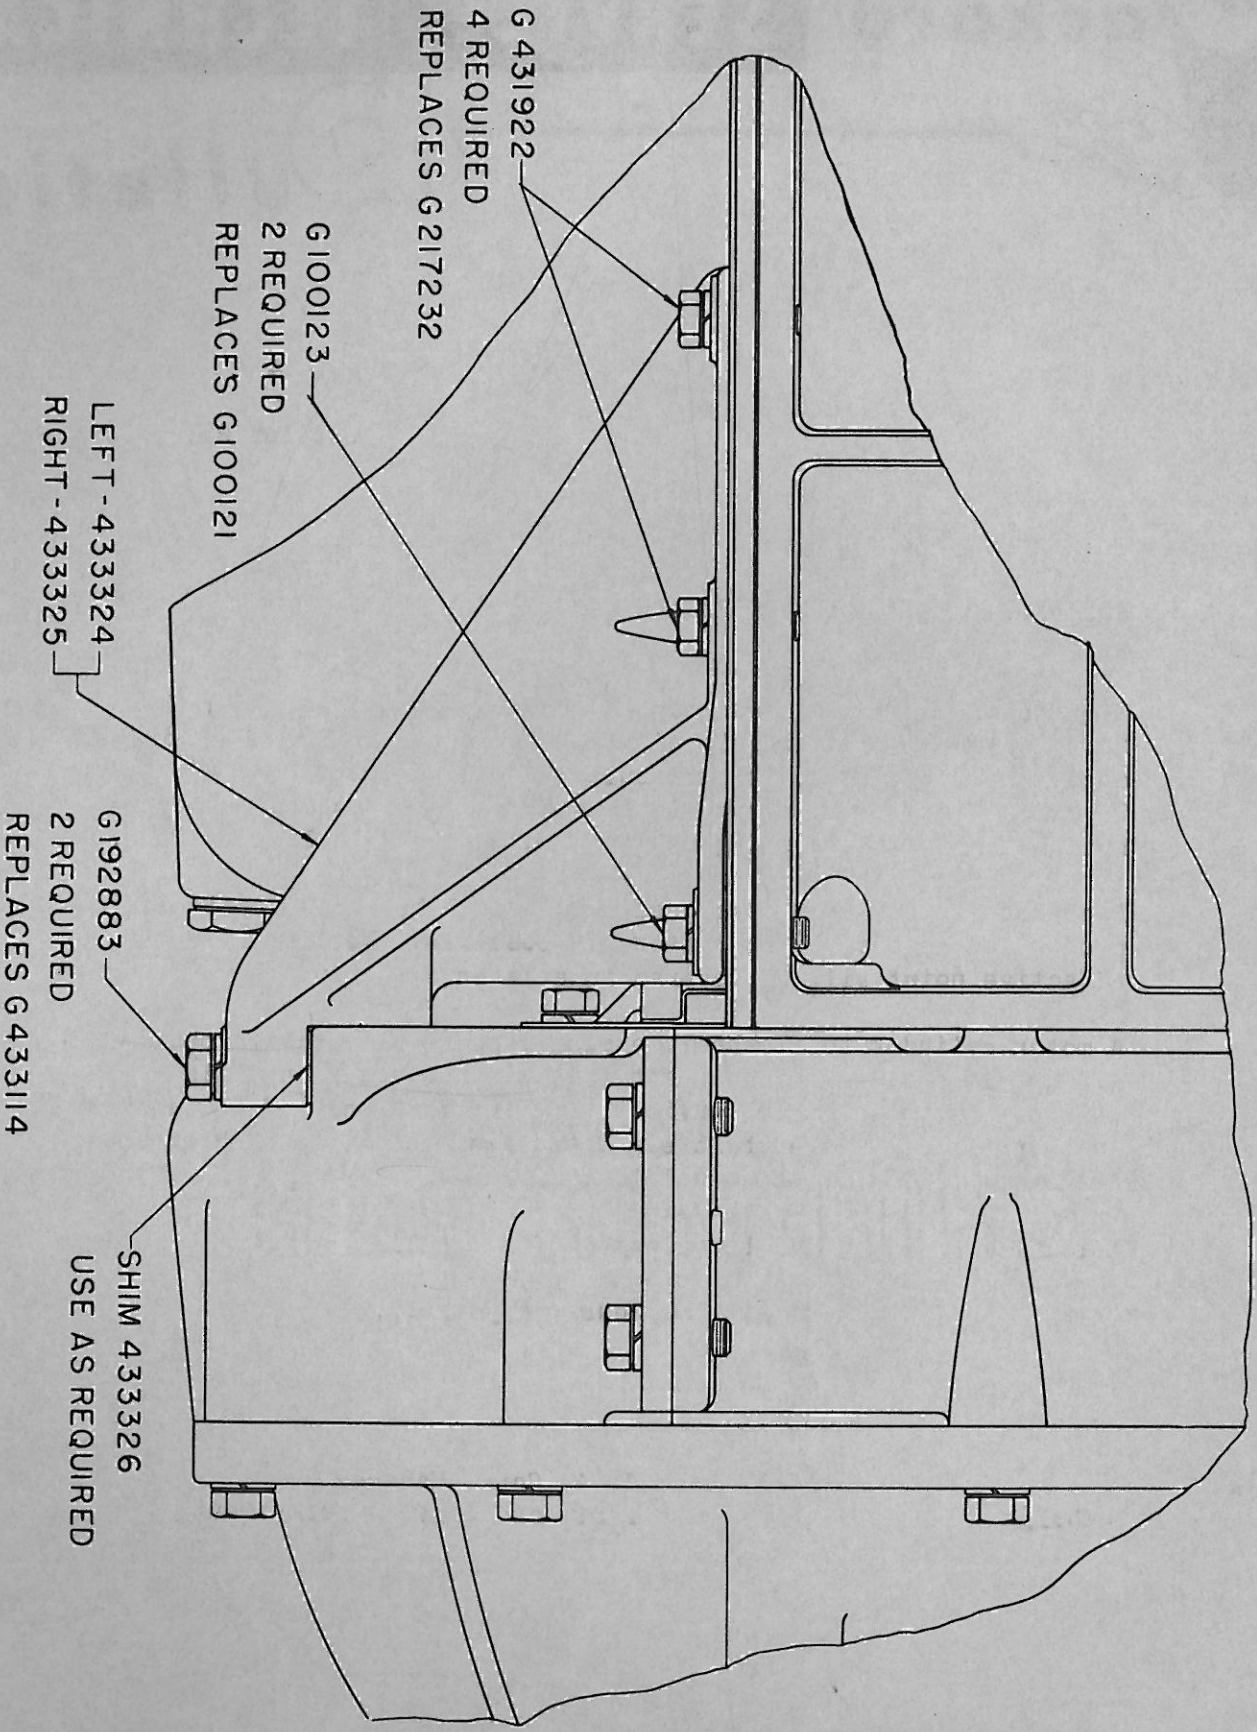

G 431922
4 REQUIRED
REPLACES G 217232

G 100123
2 REQUIRED
REPLACES G 100121

LEFT - 433324
RIGHT - 433325

G 192883
2 REQUIRED
REPLACES G 433114

SHIM 433326
USE AS REQUIRED