

Packard **SERVICE TECHNICAL** **Bulletin**

52T-23
Dealer 16
June 23, 1952

To: ZONES AND DEALERS

Subject: BODY PANEL STRIKING FRAME


There are some instances in which the body floor panel extends down below the outer body panel, permitting the extension of the floor panel metal to rub the frame.

This may cause a very audible noise or creaking sound when driving over rough roads, or when a slight twisting of the frame takes place.

It may also be noticed that this noise is increased when a heavier load is placed on the rear seat or in the trunk compartment. This occurs more often on the left side, but it can happen on the right.

To correct this condition, pry the metal away to provide sufficient clearance with the frame and the noise will cease. In some cases it may be necessary to remove the rear wheel to do a complete job.

Very truly yours,


J. A. Carr, Manager
Parts and Service Department

JAC:jh