



Packard SERVICE TECHNICAL

Bulletin

53T-5
Dealer 4
February 6, 1953

TO: Zones and Dealers

SUBJECT: WIPER CABLE SLIPPAGE - 26th Series

A slipping condition has been encountered with the 26th Series windshield wiper drivers, whereby the wiper arms and blades will only travel an inch or so and in some instances, they do not move at all.


The cable is wrapped around and clipped to the pulley at the rear of the pivot shaft inside of the wiper driver, and is supposed to drive the pivot shaft without any slippage.

It has been found that the clip does not anchor the cable to the pulley tight enough and as a result, the cable slips on the pulley.

When this condition exists, it will be necessary to replace the driver assemblies as no repairs can be made in the field.

All Trico wiper parts under Warranty are to be handled by your local Trico Dealer and not returned to the Factory, as covered in the Warranty Manual.

Very truly yours,

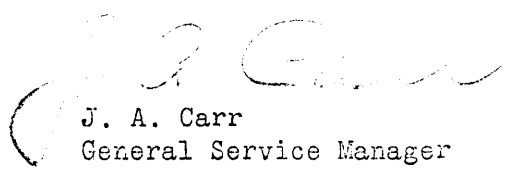

J. A. Carr
General Service Manager

JAC:kb