

Packard **SERVICE TECHNICAL** **b**ulletin

54T-8
April 12, 1954



To: ZONES ONLY

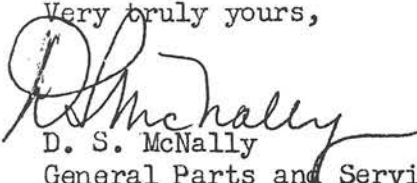
Subject: ENGINE FAN NOISE - 54TH SERIES

Excessive fan "roar" has been reported on a few 54th Series cars that are equipped with Power Steering. The noise starts at approximately 30 MPH and gets louder as the car speed increases.

This condition is generally caused by improper clearance between the fan blades and the Power Steering Pump Pulley.

The distance between the trailing edge of the fan blades and the pump pulley should be approximately $7/16$ ". If it measures $1/4$ ", replace the fan assembly using Part No. 455050. Do not attempt to bend the blades to obtain proper clearance.

Very truly yours,


D. S. McNally
General Parts and Service Manager

HGL:jb