

Packard **SERVICE TECHNICAL** **Bulletin**

55T-25
June 6, 1955

*EU 8/27
act (8)
may
Boyer BK
coil AS
thing*

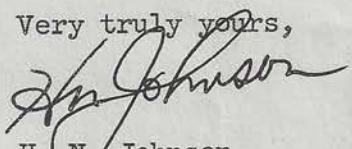
To: ZONES

Subject: IGNITION CABLE SUPPORT BRACKET - CARIBBEAN (5588)

A few early production 55th Series Caribbeans were shipped with the left rear ignition cable support bracket mounted under the valve cover corner retaining screw. With the cables mounted in this manner, it is possible for the accelerator linkage to rub the cables thus causing a shorted condition or a cross-fire.

The late production Caribbeans have the left cable rear support bracket mounted under the rear carburetor flange rear left nut.

Early production Caribbeans should be located and checked immediately for this condition and a new support bracket, part number 440929, be installed in the same manner as the right side.

Very truly yours,

H. N. Johnson
Assistant Service Manager

HGL:mu