

# Packard SERVICE TECHNICAL Bulletin

55T-34  
Dealer 25  
July 15, 1955

To: ZONES AND DEALERS

Subject: WINDSHIELD WEATHERSTRIP RETAINER - 55TH SERIES

Please refer to your Service Technical Bulletin 55T-10, Dealer 9, dated February 10, 1955, on the above subject.


Approximately January 15, production started using weatherstrips with heavier rubber at the self-locking slots to insure a tighter glass fit and prevent it from dropping out of the upper section of the weatherstrip.

Because of the slight variations in the windshield body opening, a few windshields have dropped down even with the new heavier weatherstrips. In these cases, it will be necessary to install two weatherstrip retainers as indicated and illustrated in this bulletin.

To align the glass, follow the instructions in Service Technical Bulletin 55T-10. The retainers and screws may be ordered as follows:

<u>Part No.</u>	<u>Description</u>	<u>Quantity</u>
475073	Retainer	2
G 168501	Screw	2

Very truly yours,

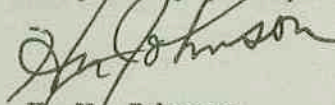

H. N. Johnson  
Assistant Service Manager

HGL:mu

