

Packard SERVICE TECHNICAL Bulletin

56T-12
Dealer 9
March 9, 1956

To: ZONES AND DEALERS

Subject: CARTER CARBURETOR - WGD-2393S

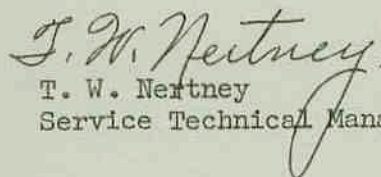
A hesitation or stumbling condition on acceleration during cold weather has been encountered on a few 5640 model cars which are equipped with the 2-barrel Carter Carburetor, model WGD-2393S.

The accelerator pump plunger, pump jet housing assembly and fast idle cam have been revised to correct this condition and are available for service installation.

The new parts can be ordered as follows:

Part No. 6484272	Pump Plunger and Check Assembly (Carter No. 64-194S)	1
Part No. 6484267	Pump Jet and Housing Assembly (Carter No. 48-195S)	1
Part No. 6484292	Fast Idle Cam Assembly (Carter No. 181-236S)	1

Very truly yours,


T. W. Nertney
Service Technical Manager

HGL:mu