

# Packard **SERVICE TECHNICAL** **Bulletin**

56T-21  
Dealer 18  
June 25, 1956

To: ZONES AND DEALERS

Subject: AIR CONDITIONING EVAPORATOR CASE WATER LEAKS -  
55TH - 56TH SERIES

A few reports have been received of water leaking out of the evaporator case just above the accelerator pedal.

Normally about 1/16" of water lays in the bottom of the evaporator case that does not drain out the drain tubes when the unit is operating.

When turning a corner sharply to the right, the water slushes over to the left, up the slight incline in the case and out through small openings where the lower cover is attached to the evaporator case if not properly sealed.

The leaks can be corrected by drying out the small cracks and openings with compressed air, then work some dum-dum as far as possible into the cracks. It may be necessary to pull back the carpet and rubber insulating pad from the corner of the case to properly seal all openings.

Very truly yours,



T. W. Nertney  
Technical Service Manager

HGL:jb