REFER TO THIS LETTER BY NUMBER


## PACKARD MOTOR CAR COMPANY


## DETROIT MICHIGAN

March 18, 1930

To: Packard Distributers and Dealers

SUBJECT: VENTILATOR LEAKS

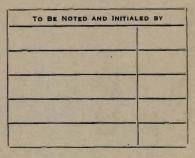

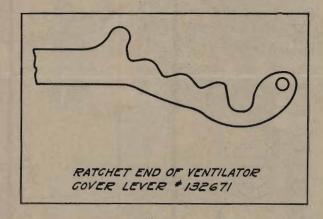

## Gentlemen:

A change has recently been made in the ventilator cover lever, piece No. 132671, which has been very successful in correcting ventilator leaks.

The illustration shows the manner in which the last notch in the lever has been deepened. This is the notch which is engaged when the ventilator is in the closed position. The increased depth of the notch greatly increases the pressure holding the ventilator lid against the rubber gasket.

In cases where ventilator leaks are encountered the old lever may be replaced with a new one, or you may simply use one of the new levers as a marking template in order to file the notch to coincide with the new pattern.

Yours very truly,

PACKARD MOTOR CAR COMPANY

T. A. Stalker,

Manager Technical Department.