



Packard SERVICE TECHNICAL

Bulletin

49T-28, Dealer 22

November 8, 1949

To: REGIONS, ZONES AND DEALERS

Subject: FRAME "X" MEMBER FLANGES SHOULD BE CHECKED
BEFORE DELIVERY


The frame "X" member on all 2301-11 cars should be checked for a bent flange on the right rear leg before delivery to the customer.

When a bent flange is found it should be straightened with a bending tool or by hammering into shape. After straightening apply a coat of black paint.

This bent flange is the result of handling during assembly and it in no way affects the frame alignment or rigidity.

Straightening before delivery to the customer or before he has seen the damage will eliminate explanations and possible owner dissatisfaction.

Very truly yours,

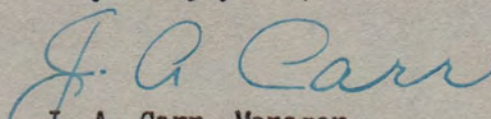

J. A. Carr, Manager
Parts and Service Department

CMK:ms