

ackard **SERVICE TECHNICAL** **Bulletin**

51T-18, Dealer 15
May 10, 1951

TO: ZONES AND DEALERS

SUBJECT: DAMAGE TO PLEXI-GLASS REAR WINDOW
CONVERTIBLE - "2469"

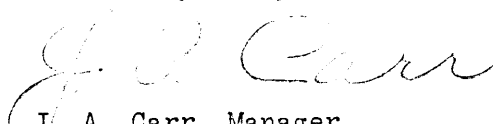
Reports have been received of scratches or indentations being found on the plexi-glass rear window.

This is caused by the window rubbing on the rear center fastener of the package tray when the top is down.

It is suggested that this fastener be removed and the hole plugged if necessary.

This center fastener at the rear will be eliminated in production.

Yours very truly,


J. A. Carr, Manager
Parts and Service Department

JAC/hs