

Packard SERVICE TECHNICAL Bulletin

50T-22, Dealer 17
May 24, 1950

To: ZONES AND DEALERS

Subject: REPLACEMENT ULTRAMATIC DRIVE GOVERNOR ASSEMBLIES

Ultramatic Drive governor assemblies are calibrated to operate with specific rear axle ratios and it is important that the correct governor be installed when a governor requires replacement.

Installing an incorrect governor assembly will result in unsatisfactory direct drive clutch engagement and disengagement.

The governor assembly used with a 3.9 or a 3.92 rear axle carries the marking "3.9 or 3.92 AXLE RATIO" stamped or etched on the outer face of the vent valve flyweight.


The governor assembly used with a 3.54 rear axle has a plain or unmarked flyweight.

The governor assembly used with 4.1 or 4.3 rear axle carries the marking "4.1 or 4.3 AXLE RATIO" on the outer face of the flyweight.

Part numbers of the governor assemblies and their flyweights are listed below. Please mark "22nd and 23rd Series Parts Lists" accordingly.

Governor Assy	Flyweight	Application
421834	421033	Use only with 3.54 rear axle ratio
423223	425221	Use only with 3.9 and 3.92 rear axle ratios
423224	425222	Use only with 4.1 and 4.3 rear axle ratios

Yours very truly,

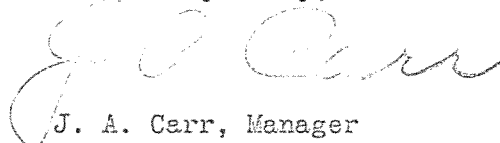

J. A. Carr, Manager
Parts and Service Department

AED:ljk