

Packard **SERVICE TECHNICAL** **Bulletin**

55T-26 REVISED
June 28, 1955

To: ZONES

Subject: TWIN ULTRAMATIC TRANSMISSION - CARIBBEAN (5588)

Because of the added torque and horsepower in the Caribbean engines, it has been necessary to install a different transmission control throttle valve idle spring and to add a spacer to the low regulator valve spring.


A few early production 55th Series Caribbean (5588) cars were shipped without the new type spring and spacer. Transmissions having the correct idle spring and low regulator valve spring spacer can be identified by a star stamped after the transmission serial number.

All Caribbeans delivered to-date should be located through the Zone Car Distributer and the transmissions inspected and altered as required.

The new springs and spacers are now available with the following part numbers:

470268	Transmission Control Throttle Valve Idle Spring
6479067	Transmission Control Low Regulator Valve Spring Spacer

Very truly yours,

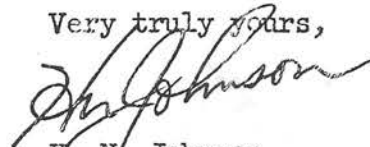

H. N. Johnson
Assistant Service Manager

HGL:mu