

# Packard **SERVICE TECHNICAL** **Bulletin**

55T-49  
Dealer 40  
November 17, 1955

To: ZONES AND DEALERS


Subject: BATTERY - NEGATIVE TERMINAL GROUNDED - 56TH SERIES

The negative terminal of the battery is grounded on all the 56th Series cars. This should be watched closely by all service personnel as Clippers and Packards for years have had the positive terminal grounded.

If the battery is found installed incorrectly some damage to the electrical system may have occurred, therefore, we suggest you install the battery correctly and polarize the generator by momentarily connecting the "B" battery terminal of the voltage regulator to the "A" armature terminal on the regulator with a jumper wire.

Check out the rest of the electrical system to see if all units function properly.

Very truly yours,

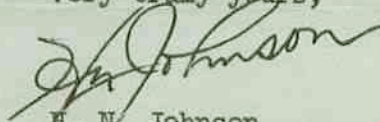

H. N. Johnson  
Assistant Service Manager

HGL:mu