

ackard **SERVICE TECHNICAL** **Bulletin**

56T-3
Dealer 2
January 18, 1956

To: ZONES AND DEALERS

Subject: DOOR LOCK STRIKER SPACERS - 56TH SERIES

One of the safety features of the new 56th Series door locks is the end plate at the rotor teeth on the door striker. The plate reduces the chance of the door lock rotor disengaging from the striker in case of an accident.


Due to the narrow width of the rotor teeth and the teeth on the striker, it is important that the door and striker be properly aligned and adjusted.

Striker plate spacers are available in 1/32, 1/16, 1/8 inch thickness and can be ordered under the following part numbers:

6485313	Door Lock Striker Plate Spacer (1/32" thick)
425757	Door Lock Striker Plate Spacer (1/16" thick)
425759	Door Lock Striker Plate Spacer (1/8" thick)

Should the striker plate (oval head) retaining screws rub the door face, we suggest you install flat head screws which are available under part number 6485324 (cadmium plated), part number 6485325 (chrome plated).

Very truly yours,

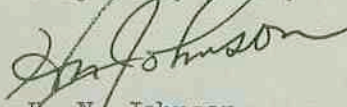

L. N. Johnson
Assistant Service Manager

HGL:mu