



Packard **SERVICE TECHNICAL**
Bulletin

49T-16, Dealer 12

July 18, 1949

To: REGIONS, ZONES AND DEALERS

SUBJECT: OVERSIZE VALVE GUIDES - MODELS 2201-02-11-22-32

A number of 22nd Series Eight and Super Eight engines were built in which the valve guides are oversize on their outer diameter only as stated in Service Technical Bulletin, Dealer 48T-16, dated June 25, 1948.


The outer diameter of these guides is .651 inch and the engines in which they were installed are identified by the suffix letter "A" after the engine number. Replacement guides for these engines are carried under part numbers 410131 - exhaust and 410132 - intake.

The outer diameter of the standard guides is .634 inch and these guides were installed in all Eight and Super Eight engines except those with the suffix "A". These standard guides are carried under numbers 403136 - exhaust and 403137 - intake.

Our Parts Warehouse records show that we are shipping oversize guides in numbers far out of proportion to that of standard guides and the limited number of suffix "A" engines built does not justify the requirements.

Dealers should check their service stock on these valve guides. Excess stock on the oversize guides may be returned to the Factory using an A.F.A. form in the usual manner.

Very truly yours,

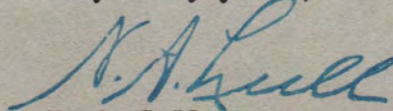

N. A. Lull
Service Technical Manager