

Packard SERVICE TECHNICAL Bulletin

55T-54
Dealer 45
December 23, 1955

To: ZONES AND DEALERS

Subject: HEADLAMP DOOR WIND WHISTLE - 56TH SERIES CLIPPERS

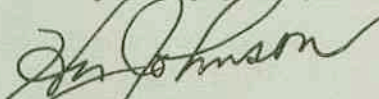
A sharp whistling noise has been encountered in the headlamp doors on a few 56th Series Clipper cars.

The whistle may be noticed at most any car speeds depending on the direction and velocity of the wind. It also appears to be coming from the front door vent windows.

However, to find if the noise is at the headlamps, place some masking tape over the crack between the headlamp door and fender from one lower corner, up over the door and down to the other corner. In some cases, the noise can be located by opening and listening out the front door windows.

If the noise is coming from the headlamp doors, loosen the door screws and fit the door as close as possible to the fender and then fill the crack with dum-dum. Smooth off the dum-dum so it will appear neat.

Very truly yours,


H. N. Johnson
Assistant Service Manager

HNJ:bjm